

CARNOVATE

TRUSTED VEHICLE REPORTS



VEHICLE INSPECTION REPORT

2009 Volkswagen Transporter

Panel Van · Diesel

Report Generated: 17 Sept 2026

TC05DUB

Introduction

Carnovate compiles this report from official and industry vehicle-data sources to give you a clear, independent view of a van's history and current status — so you can buy or sell with confidence.

Every figure in this document is drawn from records held by the DVLA, DVSA and connected vehicle-history providers. Where a data point is unavailable, it is shown as not recorded rather than estimated.

What's inside this report

- Full vehicle specification & DVLA identity
- Complete MOT history with pass, advisory & failure analysis
- Mileage timeline & anomaly detection
- Current market valuation
- Ownership, write-off, finance & stolen checks
- Vehicle imagery

Data sources: DVLA · DVSA · HPI · MIAFTR · SMMT

Guide

Each section is colour-coded so you can scan the report at a glance. Anything that needs your attention is flagged prominently — you won't have to hunt for it.



Green — Clear

No issues found for this check (e.g. valid MOT, taxed, clean history).



Amber — Advisory

Worth noting or verifying (e.g. MOT advisories, SORN, mileage to confirm).



Red — Attention

A finding that should be investigated before purchase (e.g. MOT failure, write-off, outstanding finance).

This report is based on recorded data and is not a physical inspection. We recommend confirming condition in person before completing a purchase.

Specification

Make	Volkswagen
Model	Transporter
Variant	Panel Van · Diesel
Primary Colour	Red And Silver
Fuel Type	Diesel
Engine Size	2500cc
Year of Manufacture	2009
Registration Place	Manchester
Wheel Plan	2 Axle Rigid Body
Previous Keepers	4

Records Review

We cross-checked the recorded documentation and registration data held for this van:

- Vehicle identity — make, model and registration details were located and cross-checked against DVLA records.
- The V5C logbook issue history and recorded keeper changes were reviewed for consistency.
- The MOT and mileage timelines were checked for gaps or irregular jumps.
- No conflicts were found between the registration data and the recorded vehicle specification.

This is a review of recorded data, not a check of the physical paperwork accompanying the vehicle.

Mileage Information



Mileage consistent

No discrepancies detected across recorded readings.

Last Recorded Mileage	176,501
Average Mileage / Year	10,382 mi/yr
Mileage Status	Medium
Discrepancy Detected	No

MOT




MOT Valid

Valid until 20 Apr 2027

DATE	RESULT	MILEAGE	NOTES / ADVISORIES
14 Apr 2026	PASS	176,501 mi	None recorded.
10 Apr 2025	PASS	168,595 mi	None recorded.
07 Apr 2025	FAIL	168,562 mi	MAJOR Offside Front Shock absorbers has a serious fluid leak (5.3.2 (b))
12 Apr 2024	PASS	166,035 mi	None recorded.
21 Apr 2023	PASS	164,571 mi	ADVISORY Oil leak, but not excessive (8.4.1 (a) (i))
14 Apr 2023	FAIL	164,570 mi	ADVISORY Nearside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)) ADVISORY Oil leak, but not excessive (8.4.1 (a) (i)) ADVISORY Front Tyre worn close to legal limit NSF 3.1mm OSR 2.6mm (5.2.3 (e)) MAJOR Parking brake efficiency below requirements (1.4.2 (a) (i))
29 Oct 2021	PASS	161,782 mi	None recorded.
29 Oct 2020	PASS	161,254 mi	ADVISORY Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) ADVISORY Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))
28 Oct 2020	FAIL	161,252 mi	MAJOR Nearside Front Seat belt buckle not functioning as intended (7.1.2 (d)) PRS Offside Headlamp aim too low and too far to the right (4.1.2 (a)) ADVISORY Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))
06 Dec 2019	PASS	159,507 mi	ADVISORY Nearside mirror casing damaged ADVISORY Offside mirror casing damaged ADVISORY Oil leaks from engine area

05 Dec 2019	FAIL	159,507 mi	MAJOR Nearside Stop lamp(s) not working (4.3.1 (a) (ii)) MAJOR Nearside Rear Shock absorbers has a serious fluid leak (5.3.2 (b)) MAJOR Nearside Front Lower Suspension ball joint dust cover no longer prevents ingress of dirt (5.3.4 (b) (ii)) ADVISORY Oil leaks from engine area
06 Dec 2018	PASS	151,383 mi	None recorded.
06 Dec 2018	FAIL	151,383 mi	PRS Registration plate lamp inoperative (4.7.1 (b) (ii)) PRS Nearside Anti-roll bar pin or bush excessively worn (5.3.4 (a) (i)) PRS Offside Anti-roll bar pin or bush excessively worn (5.3.4 (a) (i))
06 Dec 2017	PASS	144,236 mi	ADVISORY Oil leak
30 Nov 2017	FAIL	144,224 mi	ADVISORY Oil leak FAIL Offside Rear Direction indicator excessively damaged (1.4.A.2e) FAIL Nearside Rear Stop lamp not working (1.2.1b) FAIL Parking brake efficiency below requirements (3.7.B.7)
21 Nov 2016	PASS	138,227 mi	ADVISORY Front Oil leak ADVISORY Front Tyre worn close to the legal limit both (4.1.E.1)
01 Dec 2015	PASS	130,165 mi	ADVISORY Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i) ADVISORY Rear Brake pad(s) wearing thin (3.5.1g)
11 Nov 2014	PASS	119,767 mi	ADVISORY Offside Front CV joint gaiter deteriorated but preventing ingress of dirt (2.5.C.1a) ADVISORY Front Brake pad(s) wearing thin (3.5.1g)
25 Nov 2013	PASS	108,394 mi	None recorded.
31 Jan 2013	PASS	86,072 mi	None recorded.

MOT Insights

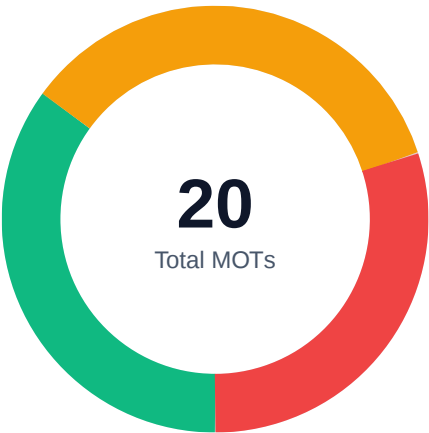

- Clear MOTs
- Advisory MOTs
- Failed MOTs

7
7
6

Based on 20 recorded MOTs · 70% pass rate

Tax check



Taxed

This vehicle is currently taxed for road use.

Tax Status	Taxed
Tax Due Date	27 Jan 2027
Average Miles / Year	10,382 mi/yr
Last V5C / Keeper Change	23 Jul 2024

Assessment

Structural & Accident Assessment

Our history check has identified an insurance write-off (Cat N) recorded against this van. Structural repairs associated with a write-off should be independently verified by a qualified inspector before purchase.

Pay particular attention to the chassis, structural members, body panels, and mounting points, panel and body alignment, and any evidence of previous repair or replacement.

This assessment is based on recorded data, not a physical examination.

Overview

Mechanical Condition Overview

This overview summarises the mechanical indicators derived from this van's MOT record and recorded advisories. Across 20 recorded MOT tests, 7 carried advisories and 6 resulted in a failure.

A full mechanical inspection by a qualified technician remains the best way to confirm the condition of the engine, transmission, braking and suspension systems before purchase.

Derived from recorded MOT and advisory history — not a physical mechanical inspection.

Insurance



Live insurance status not checked

This package does not include a real-time Motor Insurance Database (askMID) lookup.

To confirm whether this van is currently insured, you can run a free check on the Motor Insurance Database at ownvehicle.askmid.com. Driving without valid insurance is a criminal offence in the UK.

Registration	TC05DUB
Make & Model	Volkswagen Transporter

Current retail valuation

The figures below reflect current UK market data for this van at the recorded mileage. Actual sale prices vary with condition, specification and location.

£4,995

Estimated private sale value

Trade-in Value	£4,250
Private Sale	£4,995
Auction Target	£3,800

Predictions

Red Flags

No red flags identified from recorded history.

Positives

- No MOT fails at the most recent test.
- 2 consecutive clean MOTs recorded.
- No mileage discrepancies detected.



Next MOT Outlook

Pass likely — no issues recorded at the last test.

Summary

The vehicle is currently in roadworthy condition based on its recorded MOT history.

This outlook is generated automatically from recorded MOT and mileage history — a heuristic summary, not a physical inspection finding.

History Check

Our records check has flagged the following against this van: an insurance write-off (Cat N). Review the details below carefully and seek independent verification before purchase.

Security & History Checks

Write-off Recorded

Cat N

No Finance

None Outstanding

Not Stolen

MIAFTR Checked

Mileage OK

No Discrepancy

Not Scrapped

DVLA Verified

Insurance Write-off — Cat N

CATEGORY	INSURER	LOSS DATE	CLAIM NO.
Cat N	Tradewise	01 Feb 2020	226610/19 - AB1 SW

Previous Keepers

PREVIOUS KEEPERS	V5C LOGBOOKS
4	5
Keeper #4 acquired	23 Jul 2024
Keeper #3 acquired	27 Apr 2020
Keeper #2 acquired	16 Nov 2014
Keeper #1 acquired	12 Feb 2010

Plate & Colour Changes

OU59EJX to TC05DUB	25 Sep 2021
Red to Red And Silver	29 Jul 2024

Carnovate

Thank you for choosing Carnovate

This report reflects data available from the DVLA and connected vehicle-history sources at the time it was generated. For any questions about this report, get in touch below.

support@carnovate.co.uk

carnovate.co.uk

147 New Road, Dagenham, RM10 9LU